

Pre-shipment Inspection Report

Service Number: DQC-110618

Summary Section



Product Name	DEEP FAT FRYER
Item number	DMT-898
P/O number	N/A
Quantity	Order Qty.: 1700 pieces
	Finish Qty.: 1600 pieces
Client name	Confidential
Supplier name	Confidential
Inspection date	2011-06-18
Arrival time	9:30
Departure time	17:30
Inspection location	Ningbo, Zhejiang
Inspectors	Marco Li / David Song
Supervisor	Alex WONG

Category	Con	form	Comment		
Quantity	Pendir	ng	Please refer to special attention Point # 1		
Product description / style / color	Pendir	ng	Please refer to special attention Point # 2		
Workmanship		No	Beyond AQL		
Testing/ checking	Yes				
Data measurement	N/A				
Packaging	Pendir	ng	Please refer to special attention Point # 2		
Shipping mark	Yes				

Inspection Stand	ard: ANSI/ASQZ1.	4 (MIL-STD-105E)	DEFECTS			
			Critical	Major	Minor	
Sampling plan: Sir	ngle, Normal	AQL	0.0	1.5	4.0	
Inspection Level: I	I	Defects Found:	0	2	16	
Sample Size: 125 pieces Max. Allowed:			0	5	10	

OVERALL CONCLUSION	DOES NOT CONFORM
	Client provided information on action required

E-mail: info@daintily-qc.com Page 1 of 23



Special Attention

- 1. General found the factory finished 1,600pcs (94.1% of shipment order quantity), the other 100 pcs were finished and QC packed on line, they promised they would finish all goods tonight.
- 2. No submitted sample was provided by client for style & color comparison. The inspected samples were found similar to the submitted digital photo. Only Italian Manual was found in this packing. (Spec. required 2 language Italian and English)

Special Attention

DETAILED RESULTS SECTION

Quantity

Item Number	Ordered	Available	Packed	Not Packed	Sample from	Sample from
	Quantity	Quantity	Quantity	Quantity	packed Qty.	Not packed
						Qty.
DMT-898	1700pcs	1600pcs	1600Pcs /	100pcs	125pcs	0
			400 ctns			

[32] Cartons and [125] Samples were randomly sampled from the batch of above item subjected for quantitative and qualitative control respectively

Selected cartons numbers

253	37	268	232	192	134	158	281	127	241	244	276
263	240	40	278	135	332	18	249	229	296	217	110
97	260	77	400	122	136	224	265				

Product description / style / color

Check against the PO or specification by client:

Discrepancy was found on inspection samples, please refer to Special Attention point #2

Check against sample submitted by client:

The inspected samples were found similar to the submitted digital photo

No submitted sample was provided by client for style & color comparison.

E-mail: info@daintily-qc.com Page 2 of 23



Daintily Quality Consulting Website: http://www.daintily-qc.com

Workmanship

Defectives List				
Defectives Description	CRI	MAJ	MIN	Picture
Deformation of pot	0	1	0	
Non-function	0	1	0	AMER TEMP 130° 150° 170° 190° C
Dirty stains	0	0	1	OFF DISTRE

E-mail: info@daintily-qc.com Page 3 of 23



Desintily Quality Consulting Website: http://www.daintily-qc.com

Defectives Description	CRI	MAJ	MIN	Picture
Scratched mark on the surface	0	0	15	
				The state of the s

E-mail: info@daintily-qc.com Page 4 of 23



Scratched mark on the surface	

Beyond	Defectives table	Critical	Major	Minor
AQL	Total defects found	0	2	16
	Defects Max. Allowed	0	5	10
	Inspected sample size	125	125	125

E-mail: info@daintily-qc.com Page 5 of 23



TESTING /CHECKING

Function test Performed on all samples, the result was passed.

E-mail: info@daintily-qc.com Page 6 of 23





CO 234 482

Earth continually test at 25A

Earth continually test at 25A





Hi-pot test at 4300V, 0.5mA 1s

Hi-pot test at 1500V, 0.5mA 1s





Power check

Power check

E-mail: info@daintily-qc.com Page 7 of 23







Power check

Power check





Power check

Power check

Switch check

Performed on all samples, the result was passed





Switch check

Switch check

E-mail: info@daintily-qc.com Page 8 of 23






Switch check



Switch check

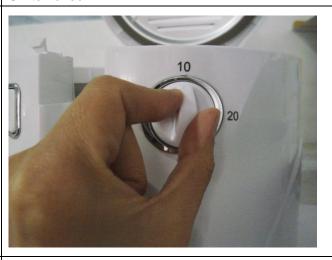

Switch check



Switch check



Switch check Swit

Switch check

E-mail: info@daintily-qc.com



POWER TEMP
130°150°170°190°C



Switch check



Switch check




Switch check

Switch check





Performed on 5 pcs samples, result is below measurement

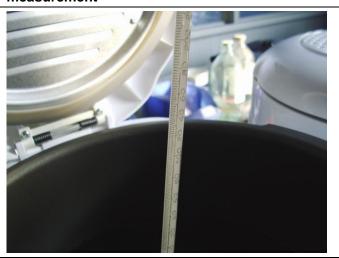

Heat

Cool 179°C

E-mail: info@daintily-qc.com Page 10 of 23




Performed on 5 pcs samples, result is below **Volume check** measurement Volume check by water Volume check (water) Volume check (2.436L) Inner check Performed on 2 pcs samples, result is satisfactory.


E-mail: info@daintily-qc.com

Inner check

Inner check




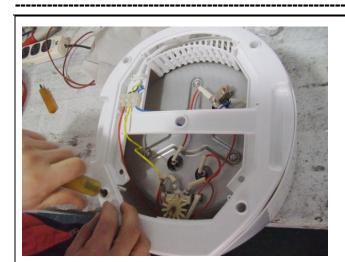

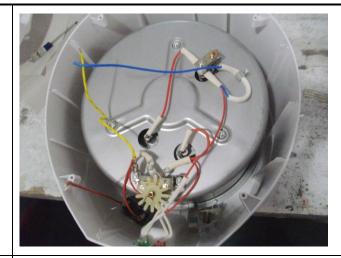

Inner check

Inner check

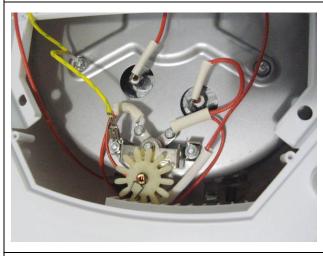



Inner check

Inner check



Performed on S-3 sample size, No printing shall be removed, the result was satisfactory.





Medical alcohol test

Medical alcohol test

E-mail: <u>info@daintily-qc.com</u> Page 12 of 23





Medical alcohol test



Medical alcohol test (concentration 95%)

POWER CORD LENGTH CHECK





POWER CORD LONG CHECK



Performed on 2 cartons, the result was passed

Carton Drop Test - from 46cm height, drop 10 times at 1 corner, 3 edges and 6 faces.



Drop test check



Drop test check

E-mail: info@daintily-qc.com Page 13 of 23







Drop test check

Drop test check





Drop test check

Drop test check

Export carton dimension check

Performed on 2 cartons, result is below.





Carton size check (L)

Carton size check (L) 67.5cm

E-mail: info@daintily-qc.com Page 14 of 23




FRIGGITRICE
MODEL NO: DMT-898
O TY: 4 PCS
N.W.: 15.8 KGS
G.W.: 20.0 KGS
MEAS: 67.5X38X60 CM
CE



Carton size check (W)

Carton size check (W)38.5cm



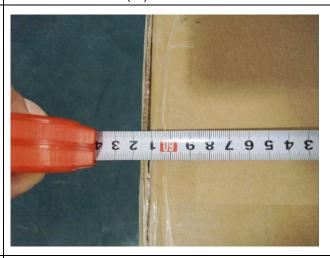

Carton size check (H)

Carton size check (H)61.5CM

G. W of unit / export carton check

Performed on 2 cartons, result is below.





Carton G.W check 4.632kgs (unit gift box check)

Carton G.W check 20.5kgs

E-mail: <u>info@daintily-qc.com</u> Page 15 of 23



Logo / Barcode label dimension check Performed on 3 pcs, result is below. TIME FRIGGITRICE MODEL NO.: DMT-898 230V~ 50Hz 1500W SERIAL NUMBER: 1109-04-Domat . Logo Rating label with Serial number Importato da: EUROSOUND SpA Interporto di Nola (Na) ITALY 1109-04-929158 Product Serial Number : EUROSOUND® e Domat®, sono marchi Della EUROSOUND S.p.A. ITALY www.domat.it

DATA MEASUREMENT

Barcode

Size Measurement table 1							
		Test c	arton				
Test description	Spec.	1	2				
Export carton dimension (L x W x H)	N/A	67.5X38.5x61.5cm	67.5X38.5x61.5cm				
G. W of carton	N/A	20.5KGS	20.5KGS				
Barcode label dimension (L x W)gift box	N/A	5.9X2.8CM	5.9x2.8CM				

Warranty card (serial number inside)

E-mail: info@daintily-qc.com Page 16 of 23



Packaging

Unit packing

Each piece was packed in gift box









Outer packing

4pcs / export carton





E-mail: info@daintily-qc.com


Page 17 of 23



Paintily Quality Consulting Website: http://www.daintily-qc.com

Shipping mark

Shipping Mark

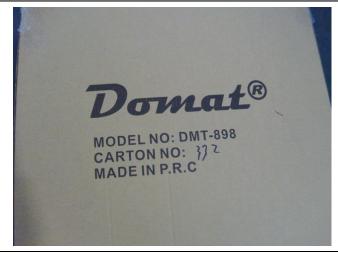



Front mark

Side mark


Other marking






Logo

Label on product

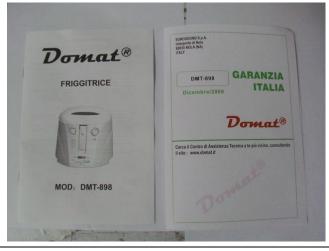

Warranty card (Serial number inside)

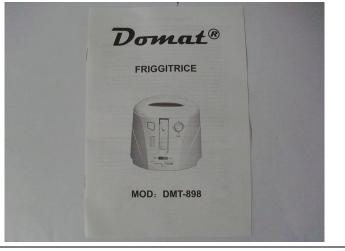

Instruction sheet

E-mail: info@daintily-qc.com Page 18 of 23





ENGLISU

TO AVOID DANGER
FROM SUFFOCATION
KEEP THESE BAGS
AWAY FROM BABIES
AND CHILDREN

FRANCE

AFIN D EVITER LE DANGER
DE SUFFOCATION NE PAS
LAISSER CES SACSA LA
PORTÉE DES RÉBÉS ETI
DES ENFANTS

GERMAN

BEUTEL WEGEN ER
VON SAUGLINGEN
UND KINDEN
UND KINDEN
FERNHALTEN


SPANISE

A FIN EVITAR EL
RIESGO DE SOFOCACION
ESTAS BOLSAS NO SE
DEBEN DE BEBES
NINOS

Bar code label

Poly bag warning



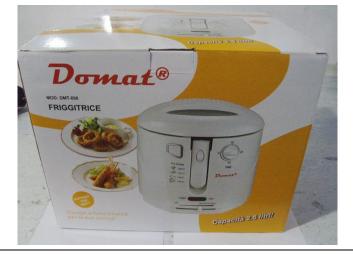

Color box printing

Color box printing






Color box printing

Color box printing

E-mail: info@daintily-qc.com Page 19 of 23



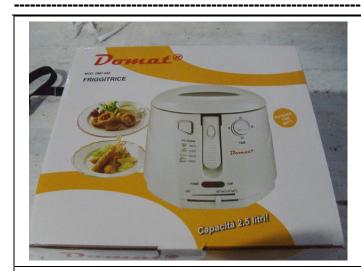


Color box printing

Other Pictures





Product

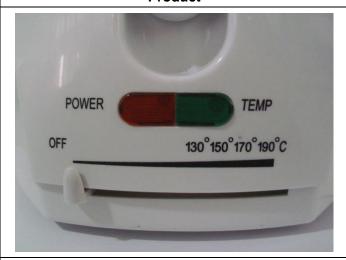


Logo



Marking 1

Marking 2

E-mail: info@daintily-qc.com

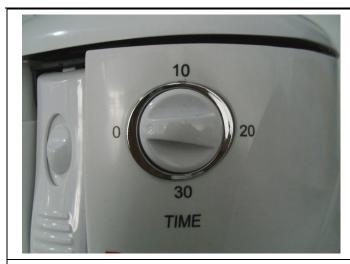

Marking 3

Marking 4





Logo

Product back view





Product top view San steam

E-mail: info@daintily-qc.com Page 21 of 23





San steam 2

Plug





Product

Product





Product

Product

E-mail: info@daintily-qc.com Page 22 of 23







Product



Product



Product

Product

Cartons





Total cartons

Inspected cartons

E-mail: info@daintily-qc.com Page 23 of 23